



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

3

D350-748-143TRN
Job Sheet 191008



Part No: D350-748-143TRN

Job Qty: 1 pcs

Part Name: Ss Crosstube Turning Detail



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 2/20/19

Job Tracking No:

Due Date: 3/22/19

Created By: Jesse White

Type: Stock

Description: SIOP

Note: DWG REV A IPP REV.A NEW ISSUE - LL 12.05.08

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		DAS Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
100	Mori Seiki TL-40 - 1	1 pcs	3/22/19	3/22/19	7.06	2.81	Mori Seiki TL-40 - 1		66 2019-04-08
110	QC 2	1 pcs	3/22/19	3/22/19	0.00	0.00	QC 2 - 1		9-89
							QC 2 - 12		
							QC 2 - 14		
							QC 2 - 17		
							QC 2 - 19		
							QC 2 - 2		
							QC 2 - 20		
							QC 2 - 22		
							QC 2 - 23		
							QC 2 - 25		
							QC 2 - 32		
							QC 2 - 33		
							QC 2 - 35		
							QC 2 - 39		
							QC 2 - 4		
							QC 2 - 40		
							QC 2 - 44		
							QC 2 - 45		
							QC 2 - 48		
							QC 2 - 49		
							QC 2 - 50		
							QC 2 - 51		
							QC 2 - 52		
							QC 2 - 54		
							QC 2 - 56		
							QC 2 - 57		
							QC 2 - 62		
							QC 2 - 63		
							QC 2 - 8		DAS
							QC 2 - 66		66 2019-04-08
									9-89

Plex 2/20/19 2:19 PM dart.white.jesse

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐																															
Date :		Sequence #:		QTY Affected :		MRB (QS1042)																													
Description Work Order Deviation				Disposition																															
				Completed By																															
				Lead hand / Supervisor																															
				QC / QA Coordinator																															
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY <table border="0"><tr><td>☐ Pressure/Forced</td><td>☐ Contamination</td><td>☐ Power Loss/Surge</td><td>☐ Positioned Wrong</td></tr><tr><td>☐ Bending</td><td>☐ Misaligned/off center</td><td>☐ Folio/Program</td><td>☐ Outside Tolerance</td></tr><tr><td>☐ Crushing</td><td>☐ BOM/Route</td><td>☐ Grain Direction</td><td>☐ Drawing</td></tr><tr><td>☐ Cracks</td><td>☐ Broken/Damage/Defect</td><td>☐ Weld</td><td>☐ Finish</td></tr><tr><td>☐ Crimp/Kink/Ripple/Wave/Twist</td><td>☐ Incomplete/Unclear Instructions</td><td>☐ Wrong Stock Pulled</td><td>☐ Part Lost/Missing</td></tr><tr><td>☐ Marks/Chatter</td><td>☐ Drill Holes</td><td>☐ Out of Sequence</td><td>☐ Misread</td></tr><tr><td>☐ Mislabeled</td><td>☐ Fit/Function</td><td>☐ Off-set/Set-up</td><td></td></tr></table>						☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance	☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish	☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread	☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up	
☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong																																
☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance																																
☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing																																
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish																																
☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																
☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread																																
☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up																																	
		Other/Details:																																	

120	Mori Seiki TL-40 - 1 - B4B	1 pcs	3/22/19	0.00 2.81	QC 2 - 64	DAS 66 2019-04-09 9-89
130	QC 2	1 pcs	3/22/19	0.00 0.00	Mori Seiki TL-40 - 1 - B4B	
					QC 2 - 1	
					QC 2 - 12	
					QC 2 - 14	
					QC 2 - 17	
					QC 2 - 19	
					QC 2 - 2	
					QC 2 - 20	
					QC 2 - 22	
					QC 2 - 23	
					QC 2 - 25	
					QC 2 - 32	
					QC 2 - 33	
					QC 2 - 35	
					QC 2 - 39	
					QC 2 - 4	
					QC 2 - 40	
					QC 2 - 44	
					QC 2 - 45	
					QC 2 - 48	
					QC 2 - 49	
					QC 2 - 50	
					QC 2 - 51	
					QC 2 - 52	
					QC 2 - 54	
					QC 2 - 56	
					QC 2 - 57	
					QC 2 - 62	
					QC 2 - 63	
					QC 2 - 8	DAS 66 2019-04-09 9-89
					QC 2 - 66	
					QC 2 - 64	
140	QC 8	1 pcs	3/22/19	0.00 0.00	QC 8 - 12	
					QC 8 - 14	
					QC 8 - 17	
					QC 8 - 20	
					QC 8 - 25	
					QC 8 - 3	
					QC 8 - 32	
					QC 8 - 33	
					QC 8 - 35	
					QC 8 - 39	
					QC 8 - 4	
					QC 8 - 44	
					QC 8 - 45	
					QC 8 - 49	
					QC 8 - 58	
					QC 8 - 8	
					QC 8 - 9	
					QC 8 - 68	DAS 67 19-05-07 9-89
					QC 8 - 67	
					QC 8 - 1 (A)	
					QC 8 - 47	
150	Crosstubes - 2 - B4B	1 pcs	3/22/19	0.00 0.97	Crosstubes - 1 - B4B	
					Crosstubes - 2 - B4B	GP 19-05-07
					Crosstubes - 3 - B4B	
					Crosstubes - 4 - B4B	
190	Packaging 3-1 - Stock - B4B	1 pcs	3/22/19	0.00 0.00	Packaging 3 - 1 - B4B	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____		Sequence #: _____		QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation				Disposition			
				Completed By			
				Lead hand / Supervisor			
				QC / QA Coordinator			
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread					
		Other/Details:					

				Packaging 3 - 2 - B4B	
				Packaging 3 - 3 - B4B	
				Packaging 3 - 4 - B4B	
				Packaging 3 - 5 - B4B	
				Packaging 3 - 6 - B4B	
				Packaging 3 - 7 - B4B	
				Packaging 3 - 8 - B4B	
				Packaging 3 - 9 - B4B	
				Packaging 3 - 10 - B4B	
				Packaging 3 - 11 - B4B	
				Packaging 3 - 12 - B4B	
				Packaging 3 - 13 - B4B	
				Packaging 3 - 14 - B4B	
				Packaging 3 - 15 - B4B	
				Packaging 3 - 16 - B4B	
				Packaging 3 - 17 - B4B	
				Packaging 3 - 18 - B4B	
				Packaging 3 - 19 - B4B	
				Packaging 3 - 20 - B4B	
				Packaging 3 - 21 - B4B	
				Packaging 3 - 22 - B4B	
				Packaging 3 - 23 - B4B	
				Packaging 3 - 24 - B4B	
				Packaging 3 - 25 - B4B	
				Packaging 3 - 26 - B4B	
				Packaging 3 - 27 - B4B	
				Packaging 3 - 28 - B4B	
				Packaging 3 - 29 - B4B	
				Packaging 3 - 30 - B4B	
				Packaging 3 - 31 - B4B	DAS 21 9-28
				Packaging 3 - 32 - B4B	
				Packaging 3 - 33 - B4B	
				Packaging 3 - 34 - B4B	MAY 08 2019
				Packaging 3 - 35 - B4B	
200	QC 21 - SA	1 pcs	3/22/19	0.00 0.00	QC 21 - SA - 21
					QC 21 - SA - 70
					QC 21 - SA - 53

Part Op **100** - (Mori Seiki CNC Lathe Large) 1-Cut tube on chop saw, leave extra mat'l for facing and install plugs 350-141 on both ends. 2-Face both sides of tube. 3- Turn program 02000 section on both side as per folio FB467. 4- Turn program 03000 section on both side as per folio FB467. 5- Blend transition lines only with belt sander 60 grit Folio rev: A

Dwg rev: A

110 - (QC2- Inspect parts off machine FAI/FAIB)

120 - (Mori Seiki CNC Lathe Large) 1- Turn program 04000 section on both side as per folio FB467. 2- Blend transition lines only with belt sander 60 grit 3- Scribe part # as per Dwg D350-748-143 Folio rev: A Dwg rev: A

130 - (QC2- Inspect parts off machine FAI/FAIB) PERFORME ULTRASONIC MEASUREMENT

140 - (QC8- Inspect parts - second check)

150 - (Crosstubes) 1-Grind machining marks

190 - (Identify as per dwg & Stock Location: _____) Identify and stock in kanban rack

200 - (QC21- Final Inspection - Work Order Release)

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D6021-125	Crosstube Material - 17-4Ph SS	1 pcs (1 ea)	100-Mori Seiki TL-40 - 1	B127271

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
100-Mori Seiki TL-40 - 1	D6021-125	1	47	0

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Part Specifications

Specifications could not be found.

Plex 2/20/19 2:19 PM dart.white.jesse

**Container No: S170330****Part: D350-748-143TRN****Job No: 191008****Serial No/Batch: S170330****Revision: A****Inspector:****Exp Date:****Instructions:**

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 813 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Date: 04/08/19

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :		Sequence #:		QTY Affected :		MRB (QSI042)	
Description Work Order Deviation				Disposition			
				Completed By			
				Lead hand / Supervisor			
				QC / QA Coordinator			
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread					
		Other/Details:					

3

DART AEROSPACE LTD	Work Order: 191008
Description: Crosstube Assembly (AS350/355 High Fwd SS)	Part Number: D350-748-143
Inspection Dwg: D350-748-143 Rev: A	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+/-0.005	2.244	✓		CNC-04	
	2.180	+0.005/-0.000	2.185	✓			
	2.180	+0.005/-0.000	2.185	✓			
	2.237	+0.005/-0.000	2.242	✓			
	2.272	+0.005/-0.000	2.277	✓			
	2.306	+0.005/-0.000	2.311	✓			
	2.339	+0.007/-0.000	2.346	✓			
	2.339	+0.007/-0.000	2.343	✓			
	0.062	+/-0.010	0.063	✓		RG	
	5.25	+/-0.060	5.257	✓		CNC-08	
	R0.063	+/-0.010	0.063	✓		RG	
	R0.50	+/-0.030	0.500	✓		"	
SIDE B	2.240	+/-0.005	2.244	✓		CNC-04	
	2.180	+0.005/-0.000	2.184	✓			
	2.180	+0.005/-0.000	2.185	✓			
	2.237	+0.005/-0.000	2.242	✓			
	2.272	+0.005/-0.000	2.277	✓			
	2.306	+0.005/-0.000	2.311	✓			
	2.339	+0.007/-0.000	2.346	✓			
	2.339	+0.007/-0.000	2.343	✓			
	0.062	+/-0.010	0.063	✓		RG	
	5.25	+/-0.060	5.255	✓		CNC-08	
	R0.063	+/-0.010	0.063	✓		RG	
	R0.50	+/-0.030	0.500	✓		"	
	112.27	+/-0.060	112.26	✓		Tape	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐																															
Date : _____		Sequence #: _____		QTY Affected : _____		MRB (QS1042)																													
Description Work Order Deviation				Disposition																															
				Completed By																															
				Lead hand / Supervisor																															
				QC / QA Coordinator																															
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY <table border="0"><tr><td>☐ Pressure/Forced</td><td>☐ Contamination</td><td>☐ Power Loss/Surge</td><td>☐ Positioned Wrong</td></tr><tr><td>☐ Bending</td><td>☐ Misaligned/off center</td><td>☐ Folio/Program</td><td>☐ Outside Tolerance</td></tr><tr><td>☐ Crushing</td><td>☐ BOM/Route</td><td>☐ Grain Direction</td><td>☐ Drawing</td></tr><tr><td>☐ Cracks</td><td>☐ Broken/Damage/Defect</td><td>☐ Weld</td><td>☐ Finish</td></tr><tr><td>☐ Crimp/Kink/Ripple/Wave/Twist</td><td>☐ Incomplete/Unclear Instructions</td><td>☐ Wrong Stock Pulled</td><td>☐ Part Lost/Missing</td></tr><tr><td>☐ Marks/Chatter</td><td>☐ Drill Holes</td><td>☐ Out of Sequence</td><td>☐ Misread</td></tr><tr><td>☐ Mislabeled</td><td>☐ Fit/Function</td><td>☐ Off-set/Set-up</td><td></td></tr></table>						☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance	☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish	☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread	☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up	
☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong																																
☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance																																
☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing																																
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish																																
☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																
☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread																																
☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up																																	
		Other/Details:																																	

③

DART AEROSPACE LTD	Work Order: 191008
Description: Crosstube Assembly (AS350/355 High Fwd SS)	Part Number: D350-748-143
Inspection Dwg: D350-748-143 Rev: A	Page 2 of 2

WALL THICKNESS MEASUREMENT

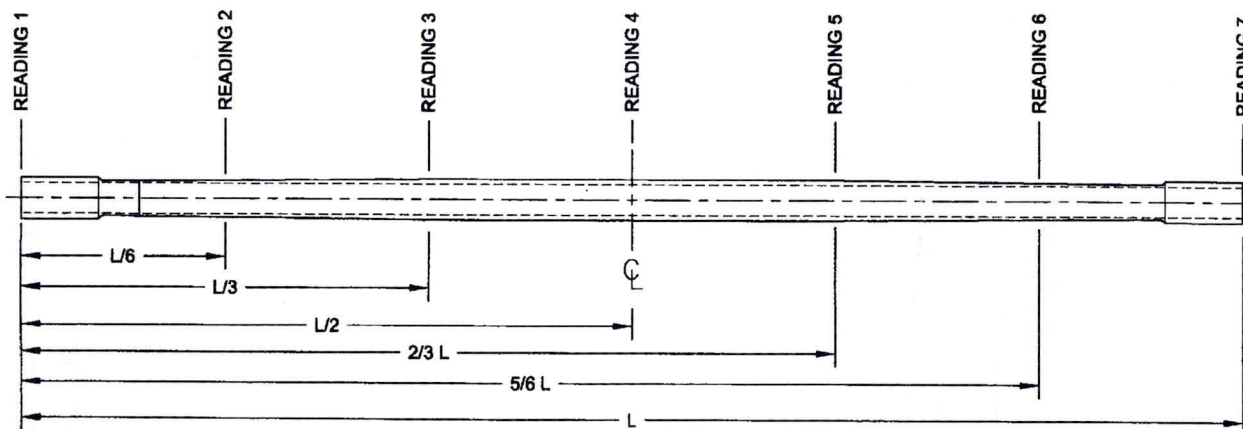

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.139	.139	.136	.136	.003	0.030"
READING 2 L= 18.71	.144	.142	.141	.142	.003	
READING 3 L= 37.42	.188	.188	.193	.192	.005	
READING 4 L= 56.14	.186	.190	.190	.186	.004	
READING 5 L= 74.85	.190	.187	.191	.193	.006	
READING 6 L= 93.56	.139	.136	.143	.148	.012	
READING 7 L= 112.27	.135	.135	.138	.139	.004	

Calibration Result

Actual Block Thickness: 100-200

Sitescan 250 Measured Thickness: 100-200

Measured by: DAS 66
Date: 2019-04-09

Audited by: DAS 67
Date: 19-04-23

Preliminary Approval:
Date:

Rev	Date	Change	Revised by	Approved
A	15.09.09	New Issue (P/O D350-748-103)	KJ	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		Other/Details: _____			

Item	Qty	Part Number	Description
	X	D350-748-143	CROSSTUBE ASSEMBLY (AS 350/355 HI FWD)
1	1	D6021-125	CROSSTUBE
2	2	D3502-1	SUPPORT
3	2	D5123-7	CLAMP CUSHION
4	1	AETC-1032	INSERT
5	2	MS21920-20 OR MS21920-21/-22	CLAMP (PER DART SPEC. M-MS21920-20/-21/-22)
6	1	NAS1149C0363R	WASHER (OR AN960C10)
7	1	NAS1635-3-8	SCREW (OR MS51958-63)
8	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6021-125 (17-4PH)
FINISHED LENGTH AFTER TURNING = 112.270±0.06 (AFTER BENDING/TRIMMING = 110.27 REF)
- FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCE: PER DART QSI 018 UNLESS OTHERWISE NOTED.
WALL THICKNESS ECCENTRICITY PER DART QSI 038 7.2
MIN. ALLOWABLE WALL IS -0.020 FROM NOMINAL
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: DART PART NUMBER 'D350-748-143' AND BATCH NUMBER ON INSIDE OF CUFF
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- WEIGHT: 30.45 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø0.290 HOLE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.

TURNING

- BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES PER SIDE. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D. ON TOP HALF OF BEND, AND 8% ON BOTTOM HALF OF BEND.
- MAX AMPLITUDE OF RIPPLING ALONG BENT PORTION OF THE TUBE IS 0.030 (ZN A1-3)
- MAX TWIST: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.38 (ZN C1-3).

ASSEMBLY

- TO INSTALL D3502-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.02" TO 0.05" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- TORQUE CLAMPS 80 TO 80 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

UNDER REVIEW

15/11/24
GRF 15-547

DEO ATTACHED

RELEASED

2015 MAR 18

4/ECN 15-547

A	NEW ISSUE	CP	15.01.21
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	15.01.21		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. D350-748-143
TITLE CROSSTUBE (AS 350/355 HI FWD)

REV. A
SHEET 1 OF 4
SCALE
NTS

COPYRIGHT © 2015 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QS1042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		Other/Details:			

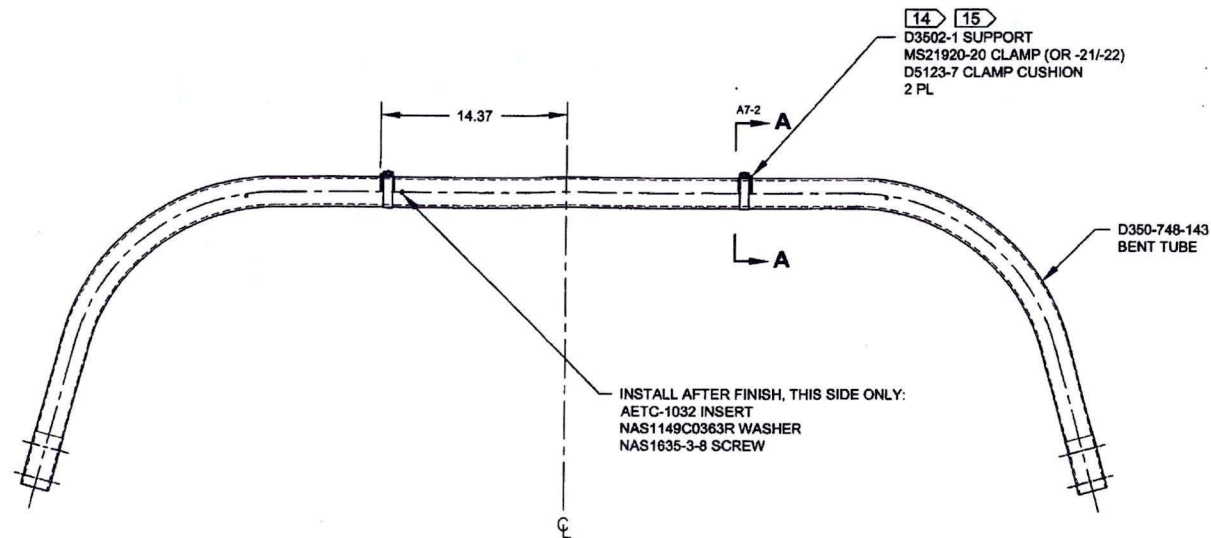

**D350-748-143
ASSEMBLY DETAIL**

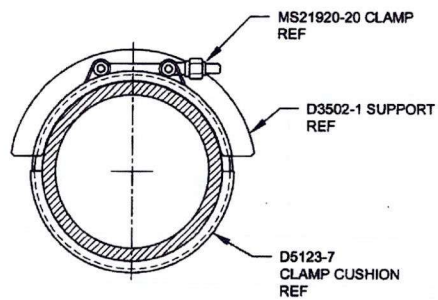

SECTION A-A D4-2
SCALE 6X

DEO ATTACHED

RELEASED

2015 MAR 18
47 ECU-15-547

UNDER REVIEW

4/15/12/23 dk
9/14/25

DESIGN	9P	DART AEROSPACE LTD	
DRAWN	9P	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. A
MFG. APPR.		D350-748-143	SHEET 2 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	15.01.21	COPYRIGHT © 2015 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐


Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

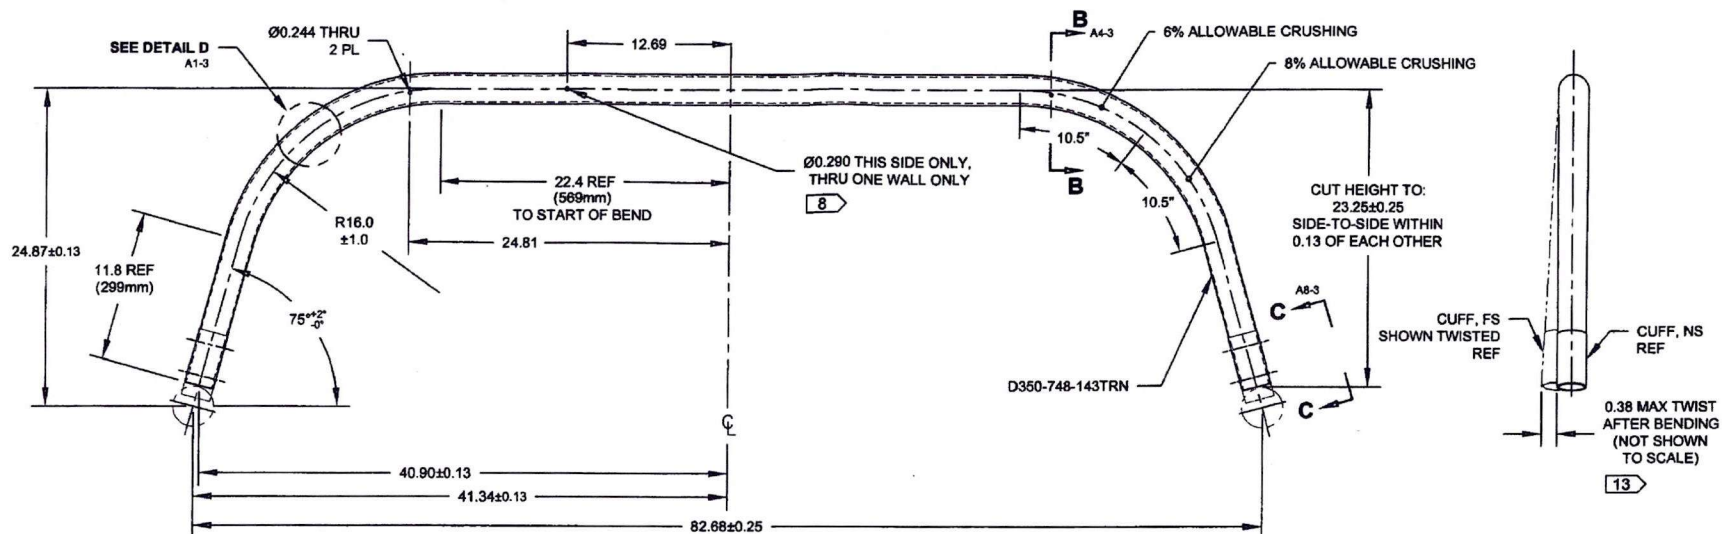

D350-748-143
BENDING AND DRILLING DETAIL 11

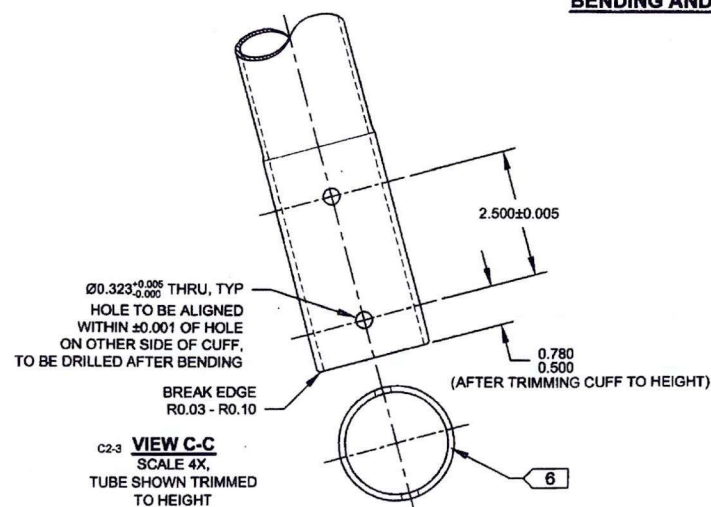

VIEW C-C
SCALE 4X,
TUBE SHOWN TRIMMED
TO HEIGHT

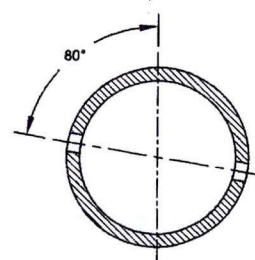


SECTION B-B D3-3
SCALE 6X

RELEASED
2015 MAR 18
DEO ATTACHED

UNDER REVIEW

15/4/28
9/2/29

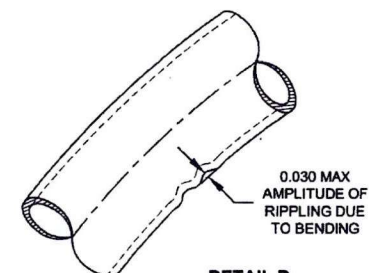

DETAIL D D7-3
SCALE 4X
RIBBLING EXAGGERATED

DESIGN	<i>g</i>	DART AEROSPACE LTD	
DRAWN	<i>g</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>AP</i>	DRAWING NO.	REV. A
MFG. APPR.	<i>[Signature]</i>	D350-748-143	SHEET 3 OF 4
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	15.01.21	COPYRIGHT © 2015 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details: _____					

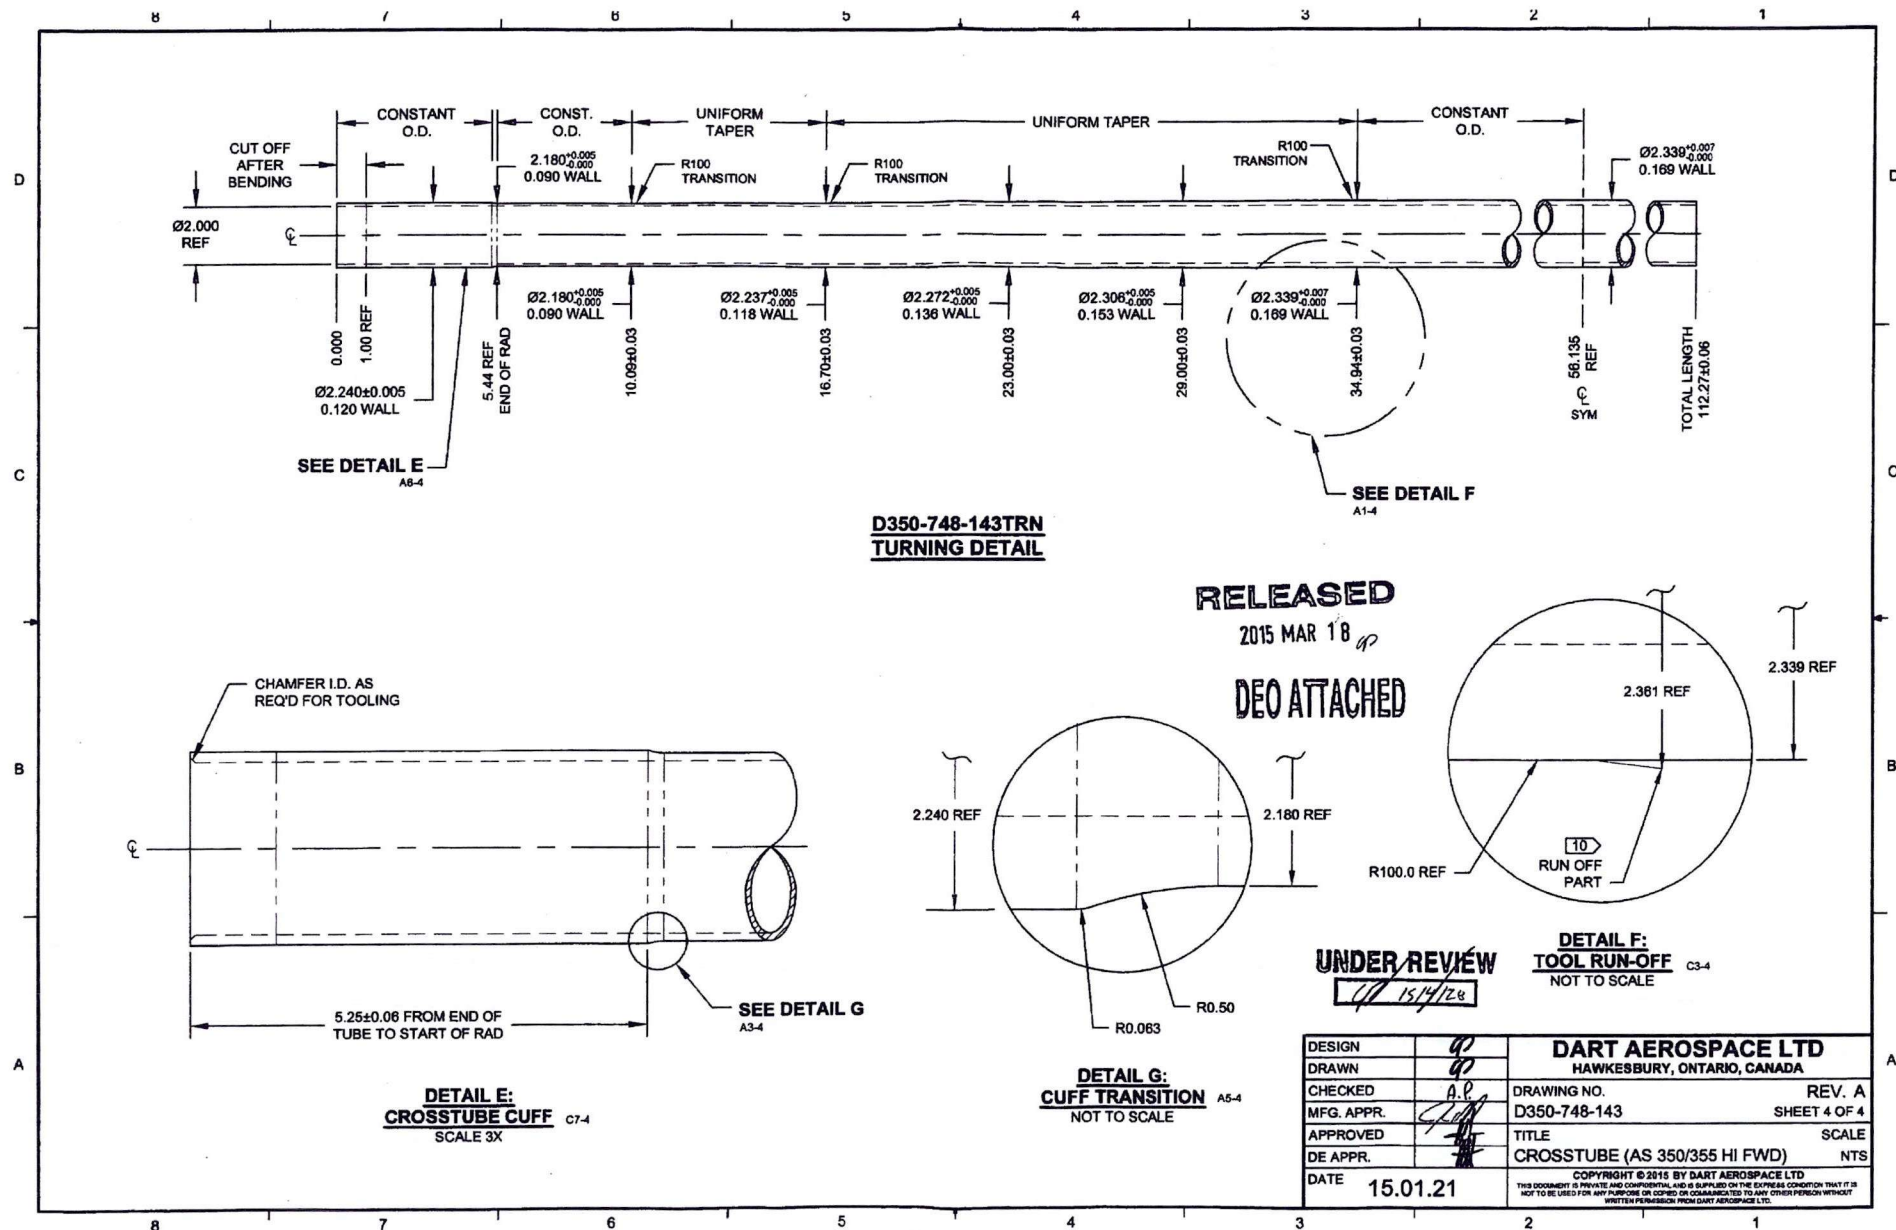

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

DRAWING NO. D350-748-143	TITLE CROSSTUBE	REV. A	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D350-748-143-A-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 92	CHECKED ASS		MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>	
DATE 15.11.18	DATE 15.11.18		DATE 16.02.19	DATE FEB 19 2016		DATE 2016.02.19	

AMEND NOTE 2 (SHEET 1) AS FOLLOWS:

2) FINISH: PREPARE SURFACE PER DART QSI 005 4.1.4
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

OR

POWDER COAT WHITE (4.3.5.2) PER DART QSI 005 4.3

RELEASED
R 2016-02-26

EW 16-534

COPYRIGHT © 2015 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE COPIED OR REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					